


LEGEND

	FENCE
	UNGRADED ROAD
	GROUND SURFACE
	ELEVATION CONTOUR
	UTILITY BOX
	DECIDUOUS TREE
	COORD. GRID (250' GRID)
	POLE
	RI/ESI MONITORING WELL
	RI/ESI SOIL BORING
	RI/ESI TEST PIT
	CONFIRMATORY PERIMETER SOIL SAMPLE LOCATION
	INTERIM PERIMETER SOIL SAMPLE LOCATION
	CONFIRMATORY FLOOR SOIL SAMPLE LOCATION (REMOVED)
	LIMIT OF INITIAL EXCAVATION
	LIMIT OF ADDITIONAL EXCAVATION
	PROPOSED LIMIT OF EXCAVATION

NOTES:

- TOPOGRAPHY BASED ON AERIAL SURVEY BY:
LOCKWOOD SURVEY
36 KARLAN DRIVE
ROCHESTER NEW YORK
- HORIZONTAL DATUM IS BASED ON NAD83 PER SENECA ARMY DEPOT SEAD 26A MONUMENTS SURVEY CONTROL COORDINATES DATED 1994.
- VERTICAL DATUM IS BASED ON NAD88.
- EACH AREA WAS EXCAVATED TO A DEPTH OF 1 FOOT.
- EXCAVATED MATERIALS WERE DIRECTLY LOADED INTO DUMP TRUCKS AND TRANSPORTED TO ONTARIO COUNTY LANDFILL BY EARTHWATCH.
- EDGES OF THE EXCAVATED AREA WERE SMOOTHED TO PREVENT TRIP HAZARDS. NO EXCESS MATERIAL WAS MOVED OR HANDLED AT THE SITE.
- THE INTERIM SAMPLE 26EXA01 FAILED TO MEET THE CLEANUP GOALS, AND THE SOIL AROUND THE INTERIM SAMPLE WAS EXCAVATED TO A DEPTH OF 1 FOOT. THE SOIL FROM WHICH THE INTERIM SAMPLE WAS COLLECTED HAS BEEN REMOVED FROM THE SITE AND IS NOT CHARACTERISTIC OF CURRENT SITE CONDITIONS.
- DEBRIS, SUCH AS CONTAINERS, VEHICLES, AND SCRAP METAL, WERE REMOVED FROM THE SITE BY THE CONTRACTOR.

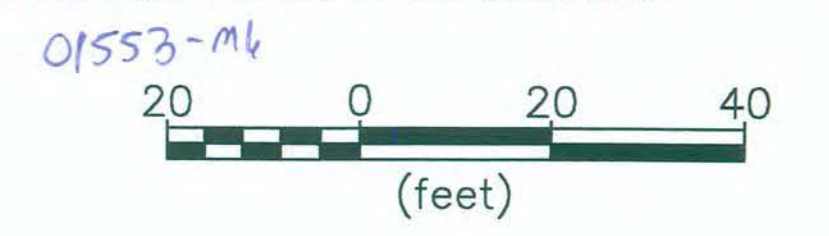

PARSONS



CLIENT/PROJECT TITLE
SENECA ARMY DEPOT
 ROMULUS, NEW YORK
 SEAD 25/26 CONSTRUCTION COMPLETION REPORT

DEPT. ENVIRONMENTAL ENGINEERING Dwg. No. 744538-03000

C-6
 EXCAVATION PLAN
 SEAD-26

SCALE AS SHOWN DATE FEBRUARY 2006 REV

P:\IT\Projects\SENECA\SEAD25-26\Preliminary Design\Construction Completion\728299-08.dwg